

Accredited for compliance with ISO/IEC 17025-Testing



Accreditation No.

## WestConnex

# **M4 East Project**

Ambient Air Quality and Weather Monitoring Validated Report

# 1<sup>st</sup> April 2018 – 30<sup>th</sup> April 2018

Report No.: DAT13156

Report issue date: 15th May 2018

Maintenance contract: MC2148

ECOTECH PTY LTD. ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email ecotech@ecotech.com WEB www.ecotech.com

This document shall not be reproduced except for in full, without the written approval of Ecotech Pty Ltd.

**Report No: DAT13156** 

## WestConnex



Customer Details		
Customer CPB Samsung John Holland Joint Venture		
Contact name Will Benson		
Address	L2, 52 Railway Parade, Burwood, NSW 2134	

Revision History			
Revision Report ID Date Analyst			
0	DAT13156	15/05/2018	Adriana Alvarez

Stavet bacet

Report by: Adriana Alvarez

**Approved Signatory:** Jon Alexander

# Report No: DAT13156

## WestConnex



### **Table of Contents**

Customer Details	2
Revision History	2
Table of Contents	3
List of Figures	4
List of Tables	4
Executive Summary	7
1.0 Introduction	8
2.0 Monitoring and Data Collection	8
2.1. Siting Details	8
2.2. Monitored Parameters	10
2.3. Data Collection Methods	11
2.3.1. Data Acquisition	13
2.4. Data Validation and Reporting	13
2.4.1. Validation	13
2.4.2. Reporting	13
3.0 Air Quality Goals	14
4.0 Calibrations and Maintenance	15
4.1. Units and Uncertainties	15
4.2. Maintenance	16
4.2.1. Calibration & Maintenance Summary Tables	16
5.0 Results	20
5.1. Data Capture	20

# **Report No: DAT13156**



5.2. Air Quality Monthly Summary	22
5.3. Tabulated data	26
5.3.1. Annual average	26
5.4. Graphic Representations	27
6.0 Valid Data Exception Tables	37
7.0 Report Summary	42
Appendix 1 - Definitions & Abbreviations	43
Appendix 2 - Explanation of Exception Table	45
List of Figures	
Figure 1: M4 East Project Monitoring Station Locations	9
Figure 2: M4 East Project Air Monitoring Stations - CO 8 hours Rolling graph for April 2018	27
Figure 3: M4 East Project Air Monitoring Stations - NO <sub>2</sub> graph for April 2018	28
Figure 4: M4 East Project Air Monitoring Stations - PM <sub>10</sub> 24 Hour graph for April 2018	29
Figure 5: M4 East Project Air Monitoring Stations - PM <sub>2.5</sub> 24 Hour graph April 2018	30
Figure 6: Allen Street – Wind Rose for April 2018	31
Figure 7: Concord Oval – Wind Rose for April 2018	32
Figure 8: Haberfield Public School – Wind Rose for April 2018	33
Figure 9: Powells Creek – Wind Rose for April 2018	34
Figure 10: Ramsay Street – Wind Rose for April 2018	35
Figure 11: Saint Lukes Park – Wind Rose for April 2018	36
List of Tables	
Table 1: WestConnex M4 NSW East Project monitoring sites locations	8

# **Report No: DAT13156**



Table 2: Parameters measured at the M4 East Project monitoring stations	10
Table 3: Methods	11
Table 4: M4 East Project - Air Quality Goals	14
Table 5: Units and Uncertainties	15
Table 6: M4 East Project Allen Street Maintenance Table April 2018	17
Table 7: M4 East Project Concord Oval Maintenance Table April 2018	17
Table 8: M4 East Project Haberfield Public School Maintenance Table April 2018	18
Table 9: M4 East Project Powells Creek Maintenance Table April 2018	18
Table 10: M4 East Project Ramsay Street Maintenance Table April 2018	19
Table 11: M4 East Project Saint Lukes Park Maintenance Table April 2018	20
Table 12: Data Capture for M4 East Project Ambient Air Quality Network	21
Table 13: M4 East Project Allen Street Exceedences Recorded for April 2018	22
Table 14: M4 East Project Concord Oval Exceedences Recorded for April 2018	23
Table 15: M4 East Project Haberfield Public School Exceedences Recorded for April 2018	23
Table 16: M4 East Project Powells Creek Exceedences Recorded for April 2018	24
Table 17: M4 East Project Ramsay Street Exceedences Recorded for April 2018	24
Table 18: M4 East Project Saint Lukes Park Exceedences Recorded for April 2018	25
Table 19: 12 months to date averages of PM <sub>10</sub> and PM <sub>2.5</sub> at the WestConnex M4 ambient air monitor station	_
Table 20: Allen Street Valid Data Exception Table	37
Table 21: Concord Oval Valid Data Exception Table	37
Table 22: Haberfield Public School Valid Data Exception Table	38
Table 23: Powells Creek Valid Data Exception Table	39

# **Report No: DAT13156**



Table 24: Ramsay Street Valid Data Exception Table	40
·	
Table 25: Saint Lukes Park Valid Data Exception Table	.41

**Report No: DAT13156** 

#### WestConnex



## **Executive Summary**

The M4 East project is a component of the WestConnex scheme, a NSW Government initiative to connect Sydney's west and south-west with the Sydney Airport and the Port Botany precinct. The project includes the widening of the existing M4 between Homebush Bay Drive and Underwood Road. Two new three-lane tunnels of approximately 5.5 km will extend from west of Pomeroy Street, Homebush to Alt Street at Haberfield. Interchanges or ramps will be upgraded or installed to allow access to/from the tunnel at the following locations: Homebush Bay Drive, Concord Road, Wattle Street and Parramatta Road at Ashfield/Haberfield. Tunnel ventilation facilities will be installed within the existing M4 road reserve near Underwood Road, Homebush and at the corner of Parramatta Road and Wattle Street at Haberfield. Operational ancillary facilities will be installed at Cintra Park. Associated road works, particularly at Parramatta Road to the M4 at Powells Creek and modification of the intersection of the existing M4 and Parramatta Road will also be undertaken as part of the works.

Ecotech Pty Ltd has been commissioned by CPB Samsung John Holland Joint Venture for air quality monitoring, data collection and reporting at six external ambient air quality monitoring stations: Allen Street AQM (Air Quality Monitoring), Powells Creek AQM, St Lukes Park AQM, Concord Oval AQM, Ramsay Street AQM and Haberfield Public School AQM.



### 1.0 Introduction

Ecotech Pty Ltd was commissioned by CPB Samsung John Holland Joint Venture to provide monitoring and data reporting for the M4 East Project ambient air quality and weather monitoring network, located as detailed in Table 1. Ecotech commenced data collection in December 2017.

This report presents the available data for April 2018.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured;
- Complies with NATA accreditation requirements, where applicable.

## 2.0 Monitoring and Data Collection

#### 2.1. Siting Details

The WestConnex M4 East Project monitoring network consists of six ambient air quality and weather monitoring stations. The stations location and siting details are described below.

Table 1: WestConnex M4 NSW East Project monitoring sites locations

Site Name	Geographical Coordinates	Height Above Sea Level (m)
Allen Street	33°51'44.21"S, 151° 5'9.79"E	3
Concord Oval	33°52'8.60"S, 151° 6'28.97"E	7
Haberfield Public School	33°52'45.70"S, 151° 8'4.01"E	26
Powells Creek	33°51'44.21"S, 151° 5'19.31"E	10
Ramsay Street	33°52'26.20"S, 151° 8'1.50"E	5
Saint Lukes Park	33°51'55.04"S, 151° 6'35.88"E	4

## WestConnex



A preliminary siting audit to assess for compliance with AS/NZS 3580.1.1:2016 was performed on 23<sup>rd</sup> July 2017. This is the Australian standard for siting of air quality monitoring stations and covers any specific requirements from AS2922-1987 and USEPA 454/R-99-005.

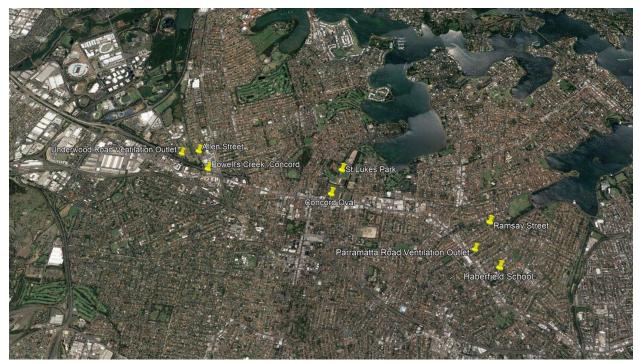


Figure 1: M4 East Project Monitoring Station Locations



#### 2.2. Monitored Parameters

Table 2 below details the parameters monitored and the instruments used at the M4 East Project monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Table 2: Parameters measured at the M4 East Project monitoring stations

Station(s)	Parameter Measured	Instrument and Measurement Technique	Elevation
	СО	Ecotech Serinus 30 – NDIR gas filter correlation infrared photometry	2 m
	NO, NO <sub>2</sub> , NO <sub>x</sub>	Ecotech Serinus 40 – gas phase chemiluminescence	2 m
	PM <sub>2.5</sub>	Met One BAM 1020 – Beta ray attenuation	2 m
Allen Street Concord Oval Haberfield Public School Powells Creek Ramsay Street Saint Lukes Park	PM <sub>10</sub>	Thermo – 1400 ab TEOM (Tapered Element Oscillating Microbalance)	2m
	Differential Temperature (elevation 2m)	Met One 062MP	2 m
	Differential Temperature (elevation 10m)	Met One 062MP	10 m
	Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
	Wind Direction (elevation 10m)	Gill Windsonic Op3	10 m
	Sigma	Calculation	-

## **Report No: DAT13156**

## WestConnex



#### 2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

**Table 3: Methods** 

Parameter Measured	Data Collection Methods Used	Description of Method	
	AS/NZS 3580.5.1 - 2011	Methods for sampling and analysis of ambient air - Method 5.1: Determination of oxides of nitrogen-Chemiluminescence method	
NO, NO <sub>2</sub> , NO <sub>x</sub>	Ecotech Laboratory Manual	In-house method 6.1 - Oxides of nitrogen by chemiluminescence	
AS/NZS 3580.7.1 - 2011		Methods for sampling and analysis of ambient air. Method 7.1:  Determination of carbon monoxide—Direct-reading instrumental method	
СО	Ecotech Laboratory Manual	In-house method 6.3 – Carbon monoxide by gas filter correlation spectrophotometry	
PM <sub>10</sub> (TEOM)	AS/NZ 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8:  Determination of suspended particulate matter - PM10 continuous direct mass method using a tapered element oscillating microbalance analyser.	
	Ecotech Laboratory Manual	In-house method 7.3- Particulates - PM2.5, PM10 by TEO	
PM <sub>2.5</sub> (BAM 1020)	AS/NZS 3580.9.12-2013 <sup>1</sup>	Methods for sampling and analysis of ambient Air - Method 9.12: Determination of suspended particulate matter—PM <sub>2.5</sub> beta attenuation monitors	
	Ecotech Laboratory Manual	In-house method 7.5 – Measurement of PM <sub>10</sub> , PM <sub>2.5</sub> and TSP using Beta Attenuation Monitor	
Vector Wind Speed (Horizontal)	AS 2923-1987 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	

<sup>&</sup>lt;sup>1</sup> As approved by the Department of Planning and Environment on 8th September 2017.

<sup>&</sup>lt;sup>2</sup> Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

### **Report No: DAT13156**

### WestConnex



Parameter Measured	Data Collection Methods Used	Description of Method	
	Ecotech Laboratory Manual	In-house method 8.1 - Wind speed (Horizontal) by anemometer	
Vector Wind	AS 2923-1987 <sup>3</sup>	Methods for sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications	
Direction	Ecotech Laboratory Manual	In-house method 8.3 - Wind direction by anemometer	
Sizzaz	AS 2923-1987 <sup>3</sup>	Methods of sampling and analysis of ambient air. Method 14 Meteorological monitoring for ambient air quality monitoring applications	
Sigma	Ecotech Laboratory Manual	In-house method 8.3 Wind direction by anemometer	
Atmospheric Temperature	USEPA (2000) EPA 454/R- 99-005 <sup>3</sup>	Methods for sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications	
	Ecotech Laboratory Manual	In-house method 8.4 – Temperature ambient by thermoelectric techniques	

Note: Two different measurement techniques are used for monitoring  $PM_{10}$  and  $PM_{2.5}$  at the M4 East Project Stations. Studies conducted in Canada, the United States and other countries have found that the Tapered Element Oscillating Microbalance (TEOM) monitors can under report concentrations compared to the Beta Attenuation Monitors (BAM), especially when the air contains a large proportion of semi-volatile particulate matter, which may be the case during cooler seasons when the air contains less coarse dust and a greater proportion of semi-volatile organic compounds such as those associated with wood smoke. As a result, it is normal to see occasional periods where  $PM_{10} < PM_{2.5}$  and this situation does not necessarily indicate a fault with either instrument.

<sup>&</sup>lt;sup>3</sup> Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

**Report No: DAT13156** 

#### WestConnex



#### 2.3.1. Data Acquisition

Data acquisition is performed using a PC based WinAQMS logger (using WinAQMS® Version 2.0) situated at each of the monitoring sites. Each logger is equipped with a 3G modem for remote data collection. The recorded data is remotely collected from the Air Quality Monitoring Station (AQMS) loggers on a daily basis (using Airodis<sup>TM</sup> version 5.1.0) and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

#### 2.4. Data Validation and Reporting

#### 2.4.1. Validation

The Ecotech ERS department performs daily data checks to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g. backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five minutes and one-hour data as appropriate.

#### 2.4.2. Reporting

Data is reported in six Microsoft Excel format files named

- WestConnex\_M4\_Allen St\_ Monthly Data Report\_April 2018.xls
- WestConnex M4 Concord Oval Monthly Data Report April 2018.xls
- WestConnex\_M4\_Haberfield School\_ Monthly Data Report\_April 2018.xls
- WestConnex\_M4\_Powells Creek\_ Monthly Data Report\_April 2018.xls
- WestConnex M4 Ramsay St Monthly Data Report April 2018.xls
- WestConnex M4 St Lukes Park Monthly Data Report April 2018.xls

Each Excel file consists of 5 worksheets:

- 1. Cover
- 2. 5 Minute Data

## **Report No: DAT13156**

#### WestConnex



- 3. 1 Hour Data
- 4. 24-hour Data
- 5. Valid Data Exception Report

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute and the one-hour data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g. monthly maximum and minimum) may be based on less than 75% valid samples. The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e. the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

## 3.0 Air Quality Goals

The air quality goals and criteria for pollutants monitored at the M4 East project ambient monitoring sites are based on SSI 6307 Planning Approval Condition E9. The air quality goals and criteria are shown in Table 4 below.

**Table 4: M4 East Project - Air Quality Goals** 

Parameter	Time Period	Goal Level	Units
СО	8 hours (rolling, based on 1-hour averages)	9.0	ppm
NO <sub>2</sub>	1 hour	0.12	ppm
DM	1 day	50	μg/m³
PM <sub>10</sub>	1 year	25	μg/m³
DAA	1 day	25	μg/m³
PM <sub>2.5</sub>	1 year	8	μg/m³

### **Report No: DAT13156**

#### WestConnex



#### Note:

Exceptional events are excluded from this standard. As per the Ambient Air Quality NEPM, *Exceptional event* means a fire or dust occurrence that adversely affects air quality at a particular location and causes an exceedance of 1-day average standards in excess of normal historical fluctuations and background levels and is directly related to: bushfire; jurisdiction authorized hazard reduction burning; or continental scale windblown dust.

Ecotech will include any valid data identified as being associated with an exceptional event in all report tables and graphic representations. For this reason, and as the project monitoring results are part of the baseline monitoring regime, 1-day averages associated with exceptional events will not be counted as exceedences of the Air Quality goals. Monitoring and reporting of exceedences during the operational project will be in accordance with the Planning Approval Conditions E10, E11 and E12.

#### 4.0 Calibrations and Maintenance

#### 4.1. Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturer's tolerance limits of the equipment's parameters, and by the data collection standard method.

The reported uncertainties are expanded uncertainties, calculated using coverage factors which give a level of confidence of approximately 95%.

**Table 5: Units and Uncertainties** 

Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>4</sup>
NO, NO <sub>x</sub> (S40)	pphm	0.01 pphm	±1.3 pphm or 10% of reading, whichever is the greater k factor of 2.0	0 to 50 pphm
NO <sub>2</sub> (S40)	pphm	0.1 pphm	± 1.7 pphm k factor of 2.0	0 to 50 pphm

<sup>&</sup>lt;sup>4</sup> Uncertainties may not be calculated based on the full measurement range.

## **Report No: DAT13156**

### WestConnex



Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>4</sup>
CO (S30)	ppm	0.1 ppm	± 1 ppm or 10% of reading, whichever is the greater k factor of 2.0	0 to 50 ppm
PM <sub>2.5</sub> (BAM1020)	μg/m³	1 μg/m³	$\pm 5.0$ μg/m³ + 5.4% of reading K factor of 2.0	5 to 1000 μg/m³
PM <sub>10</sub> (TEOM)	μg/m³	0.1 μg/m³	$\pm 5.0~\mu g/m^3$ or 3.6% of reading, whichever is the greater K factor of 2.0	0 μg/m³ to 1 g/m³
Vector Wind Speed	m/s	0.1 m/s	±0.4 m/s or 2 % of reading, whichever is greater K factor of 2.0	0 to 30 m/s
Vector Wind Direction	deg	1 deg	±4 deg K factor of 2.0	0 to 360 deg Starting threshold: 0 m/s
Atmospheric Temperature	К	0.1 K	±0.6 K K factor of 2.0	273.15 to 323.15 K

#### 4.2. Maintenance

#### 4.2.1. Calibration & Maintenance Summary Tables

The last calibrations for the following parameters were performed on the indicated dates. Data supplied after this time is subject to further validation, to be performed at the next calibration cycle.

Note: Maintenance and calibration dates may differ, as calibrations may be less frequent than scheduled maintenance visits.

Tables 6-11 indicate when the particulate and gas and meteorological equipment were last maintained/calibrated.



Table 6: M4 East Project Allen Street Maintenance Table April 2018

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	26/04/2018	Monthly	26/04/2018	Monthly
СО	26/04/2018	Monthly	26/04/2018	Monthly
PM <sub>10</sub>	26/04/2018	Monthly	22/02/2018	3-monthly
PM <sub>2.5</sub>	26/04/2018	Monthly	22/02/2018	3-monthly
WS/WD/Sigma	26/04/2018	Monthly	06/10/2017	2 yearly
Differential Temperature 2m	26/04/2018	Monthly	8/09/2017	Yearly
Differential Temperature 10m	26/04/2018	Monthly	8/09/2017	Yearly

**Table 7: M4 East Project Concord Oval Maintenance Table April 2018** 

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	24/04/2018	Monthly	24/04/2018	Monthly
СО	24/04/2018	Monthly	24/04/2018	Monthly
PM <sub>10</sub>	24/04/2018	Monthly	19/02/2018	3-monthly
PM <sub>2.5</sub>	24/04/2018	Monthly	19/02/2018	3-monthly
WS/WD/Sigma	24/04/2018	Monthly	06/10/2017	2 yearly
Differential Temperature 2m	24/04/2018	Monthly	8/09/2017	Yearly

## **Report No: DAT13156**



Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
Differential Temperature 10m	24/04/2018	Monthly	8/09/2017	Yearly

Table 8: M4 East Project Haberfield Public School Maintenance Table April 2018

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	26/04/2018	Monthly	26/04/2018	Monthly
СО	23/04/2018	Monthly	23/04/2018	Monthly
PM <sub>10</sub>	23/04/2018	Monthly	20/02/2018	3-monthly
PM <sub>2.5</sub>	26/04/2018	Monthly	20/02/2018	3-monthly
WS/WD/Sigma	23/04/2018	Monthly	05/10/2017	2 yearly
Differential Temperature 2m	23/04/2018	Monthly	11/09/2017	Yearly
Differential Temperature 10m	23/04/2018	Monthly	11/09/2017	Yearly

Table 9: M4 East Project Powells Creek Maintenance Table April 2018

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	26/04/2018	Monthly	26/04/2018	Monthly
СО	26/04/2018	Monthly	26/04/2018	Monthly
PM <sub>10</sub>	26/04/2018	Monthly	15/02/2018	3-monthly

**Report No: DAT13156** 



Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
PM <sub>2.5</sub>	26/04/2018	Monthly	15/02/2018	3-monthly
WS/WD/Sigma	26/04/2018	Monthly	06/10/2017	2 yearly
Differential Temperature 2m	26/04/2018	Monthly	11/09/2017	Yearly
Differential Temperature 10m	26/04/2018	Monthly	11/09/2017	Yearly

Table 10: M4 East Project Ramsay Street Maintenance Table April 2018

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	23/04/2018	Monthly	23/04/2018	Monthly
СО	23/04/2018	Monthly	23/04/2018	Monthly
PM <sub>10</sub>	23/04/2018	Monthly	16/02/2018	3 monthly
PM <sub>2.5</sub>	23/04/2018	Monthly	16/02/2018	3-monthly
WS/WD/Sigma	23/04/2018	Monthly	05/10/2017	2 yearly
Differential Temperature 2m	23/04/2018	Monthly	7/09/2017	Yearly
Differential Temperature 10m	23/04/2018	Monthly	7/09/2017	Yearly

### WestConnex



Table 11: M4 East Project Saint Lukes Park Maintenance Table April 2018

Parameter	Date of Last Maintenance	Maintenance Type	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	24/04/2018	Monthly	24/04/2018	Monthly
СО	24/04/2018	Monthly	24/04/2018	Monthly
PM <sub>10</sub>	24/04/2018	Monthly	14/02/2018	3-monthly
PM <sub>2.5</sub>	24/04/2018	Monthly	14/02/2018	3-monthly
WS/WD/Sigma	24/04/2018	Monthly	09/10/2017	2 yearly
Differential Temperature 2m	24/04/2018	Monthly	8/09/2017	Yearly
Differential Temperature 10m	24/04/2018	Monthly	8/09/2017	Yearly

#### 5.0 Results

#### **5.1.** Data Capture

Valid data capture refers to the amount of valid data collected during the report period. It is based on 5-minute data, for gaseous and meteorological parameters and 1-hour data for particulate parameters.

The percentage of valid data captured is calculated using the following equation:

Valid Data capture = (Reported air quality data / Total data) x 100%

#### Where:

 Reported air quality data = Number of samples (instrument readings) which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, equipment failures, planned and unplanned maintenance.

**Report No: DAT13156** 

### WestConnex



• Total data = Total number of samples (instrument readings) expected for the sampling period. Total data is calculated based on the same averaging period as "reported air quality data" and the duration of the corresponding report period. e.g. for 5 minute data collected over a month of 31 days, the total data would be equal to 12 (5 minute samples in an hour) x 24 (hours in a day) x 31 (days in a month) = 8928 samples.

Table 12 below displays data capture statistics for April 2018. **Bold** values in the table indicate data capture below 95%.

Details of all invalid or missing data affecting data capture are included in the Valid Data Exception Tables, see section 6.0.

Table 12: Data Capture for M4 East Project Ambient Air Quality Network

		Data Capture (%)				
Parameter	Allen Street	Concord Oval	Haberfield School	Powells Creek	Ramsay Street	Saint Lukes Park
PM <sub>2.5</sub>	99.3	99.4	98.8	99.4	99.4	98.6
PM <sub>10</sub>	99.7	99.6	99.0	99.8	99.4	99.6
СО	97.2	96.4	96.0	96.6	96.1	96.1
NO, NO <sub>2</sub> , NO <sub>x</sub>	96.2	96.6	95.2	97.2	96.4	95.1
WS,WD, Sigma	99.7	99.6	99.4	99.8	98.3	99.6
AT 2m	99.7	99.6	99.4	99.8	99.6	99.6
AT 10m	99.7	99.6	99.4	99.8	99.6	99.6

## WestConnex



## **5.2.** Air Quality Monthly Summary

Tables 13-18 below include a summary of any exceedances recorded at the M4 East Project stations during the reported period<sup>5</sup>.

Table 13: M4 East Project Allen Street Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8 hour rolling	-	-
PM <sub>10</sub> (μg/m³)	24 hour	-	-
	Annual <sup>6</sup>	-	-
DN4 (ug/m3)	24 hour	26	13/04/2018
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>6</sup>	-	-

<sup>&</sup>lt;sup>5</sup> Exceedances are based on the decimal places reported.

<sup>&</sup>lt;sup>6</sup> Insufficient data to report annual average, any exceedences will be reported in January 2019.

**Report No: DAT13156** 

## WestConnex



Table 14: M4 East Project Concord Oval Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8 hour rolling	-	-
PM <sub>10</sub> (μg/m³)	24 hour	-	-
	Annual <sup>7</sup>	-	-
DN4 (ug/m3)	24 hour	-	-
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>7</sup>	-	-

Table 15: M4 East Project Haberfield Public School Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence		
NO <sub>2</sub> (ppm)	1 hour	-	-		
CO (ppm)	8 hour rolling	-	-		
DA4 ((3)	24 hour	-	-		
PM <sub>10</sub> (μg/m³)	Annual <sup>7</sup>	-	-		
PM <sub>2.5</sub> (μg/m³)	24 hour	-	-		
	Annual <sup>7</sup>	-	-		

<sup>7</sup> Insufficient data to report annual average, any exceedences will be reported in January 2019.

**Report No: DAT13156** 



Table 16: M4 East Project Powells Creek Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence		
NO <sub>2</sub> (ppm)	1 hour	-	-		
CO (ppm)	8 hour rolling	-	-		
200 / / 3)	24 hour	-	-		
PM <sub>10</sub> (μg/m³)	Annual <sup>8</sup>	-	-		
20.0	24 hour	28	13/04/2018		
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>8</sup>	-	-		

Table 17: M4 East Project Ramsay Street Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence	
NO <sub>2</sub> (ppm)	1 hour	-	-	
CO (ppm)	8 hour rolling	-	-	
DA4 ((3)	24 hour	50.8	26/04/2018	
PM <sub>10</sub> (μg/m³)	Annual <sup>8</sup>	-	-	
PM <sub>2.5</sub> (μg/m³)	24 hour	-	-	
	Annual <sup>8</sup>	-	-	

<sup>&</sup>lt;sup>8</sup> Insufficient data to report annual average, any exceedences will be reported in January 2019.

WestConnex



Table 18: M4 East Project Saint Lukes Park Exceedences Recorded for April 2018

Parameter	Time Period	Value of Exceedence	Date of Exceedence		
NO <sub>2</sub> (ppm)	1 hour	-	-		
CO (ppm)	8 hour rolling	-	-		
DAA / . / .3)	24 hour	-	-		
PM <sub>10</sub> (μg/m³)	Annual <sup>9</sup>	-	-		
PM <sub>2.5</sub> (μg/m³)	24 hour	-	-		
	Annual <sup>9</sup>	-	-		

<sup>9</sup> Insufficient data to report annual average, any exceedences will be reported in January 2019.

### WestConnex



#### 5.3. Tabulated data

#### 5.3.1. Annual average

Table 19 displays monthly averages of the  $PM_{2.5}$  and  $PM_{10}$  parameters collected at M4 East project ambient air monitoring stations data from the start of monitoring ( $22^{nd}$  December 2017) to the end current reported month. Table requires at least 75% valid data to display a monthly average. Footer values are based on all available data rather than the average of individual months. This gives an indication of performance against the annual objectives. These figures should not be considered valid until 12 months monitoring has been completed.

Table 19: 12 months to date averages of  $PM_{10}$  and  $PM_{2.5}$  at the WestConnex M4 ambient air monitoring station  $^{10}$ 

Month	Allen Street		Concord Oval		Haberfield school		Powells Creek		Ramsay Street		Saint Lukes Park	
	PM <sub>10</sub> (μg/m³)	PM <sub>2.5</sub> (μg/m³)	PM10 (μg/m³)	PM2.5 (μg/m³)	PM10 (μg/m³)	PM2.5 (μg/m³)						
Dec/17 <sup>11</sup>	ı	-	ı	ı	ı	-	-	ı	ı	-	-	-
Jan/18	19.9	8	25.4	9	20.1	9	25.5	10	21.8	9	20.0	7
Feb/18	19.0	5	24.1	8	19.9	10	24.1	9	22.0	9	19.5	7
Mar/18	23.9	7	26.8	8	22.0	13	26.6	10	26.0	10	22.0	8
Apr/18	24.1	10	26.3	10	22.3	11	27.0	12	25.7	12	22.7	10
Average	21.8	7.4	25.7	8.8	21.1	10.8	25.8	10.2	23.9	10.1	21.1	8.4

 $<sup>^{10}</sup>$  Note: data collection commenced in December 2017; therefore, 12 consecutive months of data has not yet been recorded.

<sup>&</sup>lt;sup>11</sup> Less than 75% data available for December 2017

### WestConnex



### 5.4. Graphic Representations

This section displays graphs of the pollutants and meteorological parameters monitored at the M4 East sites for April 2018. The graphs are based on validated 5 minutes or 1-hour data as appropriate.

## CO 8 hours (rolling, based on 1 hour average) April 2018 Allen St CO 8hr Avg Concord Oval CO 8hr Avg Haberfield PS CO 8hr Avg Powells Creek CO 8hr Avg Ramsay St CO 8hr Avg St Lukes Park CO 8hr Avg 8 7 Volumetric Concentration (ppm) 6 3 2 1 15 Sun 22 Sun 8 Sun 1 Tue Apr 2018

Figure 2: M4 East Project Air Monitoring Stations - CO 8 hours Rolling graph for April 2018



## NO<sub>2</sub> 1 hour average

April 2018 Concord Oval NO<sub>2</sub> 1hr Avg St Lukes Park NO2 1hr Avg

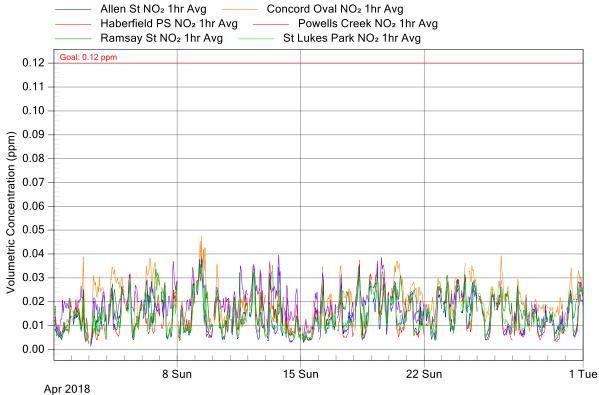


Figure 3: M4 East Project Air Monitoring Stations - NO<sub>2</sub> graph for April 2018



## PM<sub>10</sub> 24 hour average

April 2018

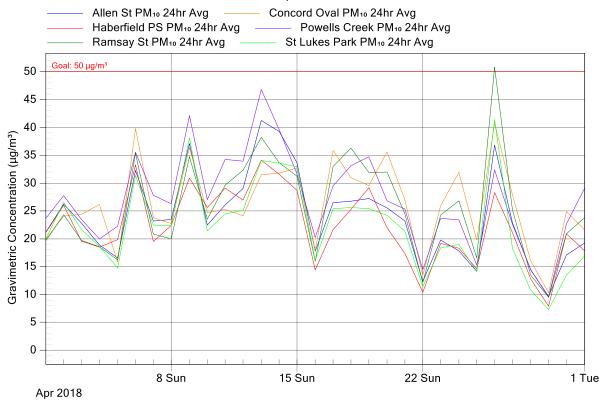


Figure 4: M4 East Project Air Monitoring Stations - PM<sub>10</sub> 24 Hour graph for April 2018



## PM<sub>2.5</sub> 24 hour average

April 2018


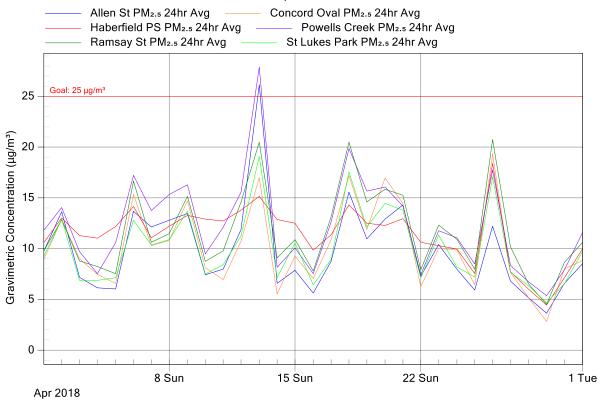


Figure 5: M4 East Project Air Monitoring Stations - PM<sub>2.5</sub> 24 Hour graph April 2018



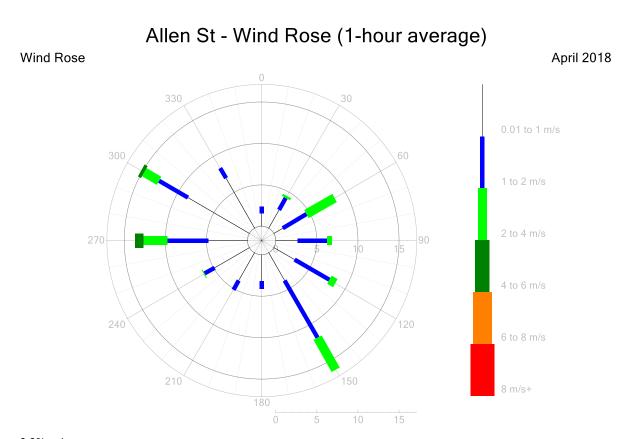


0.0% calm 99.7% valid data present

Figure 6: Allen Street - Wind Rose for April 2018





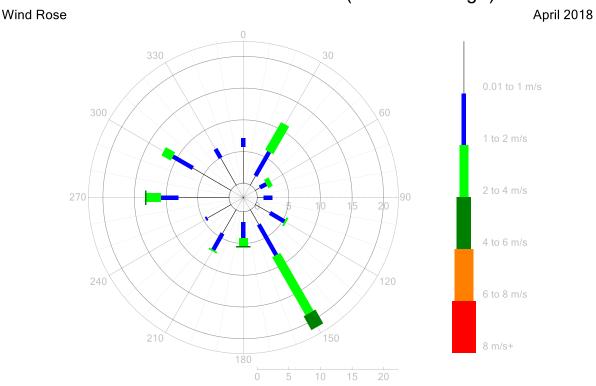


0.0% calm 99.4% valid data present

Figure 7: Concord Oval - Wind Rose for April 2018



## Haberfield Public School - Wind Rose (1-hour average)

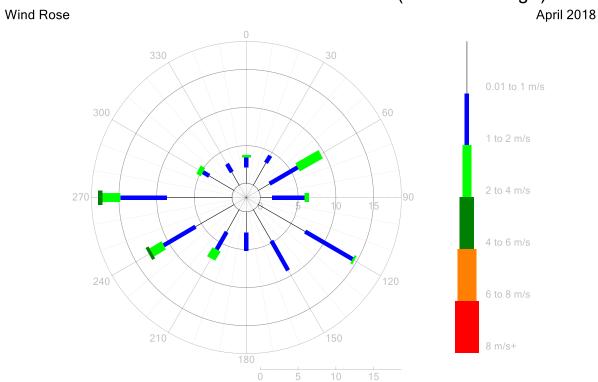


0.0% calm 99.3% valid data present

Figure 8: Haberfield Public School – Wind Rose for April 2018







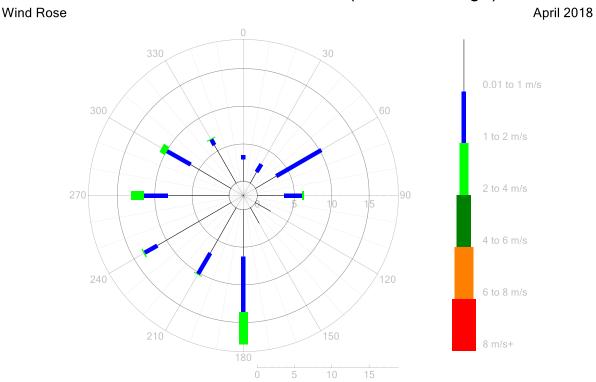


0.0% calm 99.7% valid data present

Figure 9: Powells Creek - Wind Rose for April 2018

## WestConnex





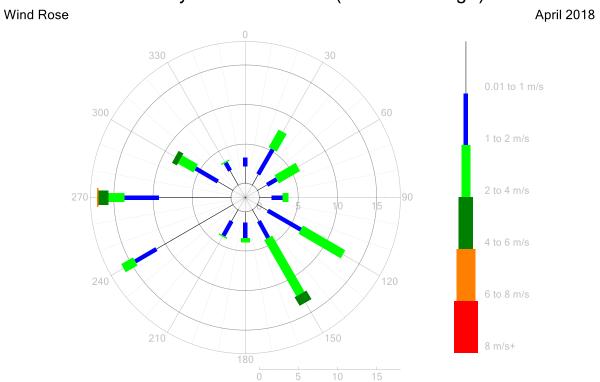


0.1% calm 98.2% valid data present

Figure 10: Ramsay Street – Wind Rose for April 2018







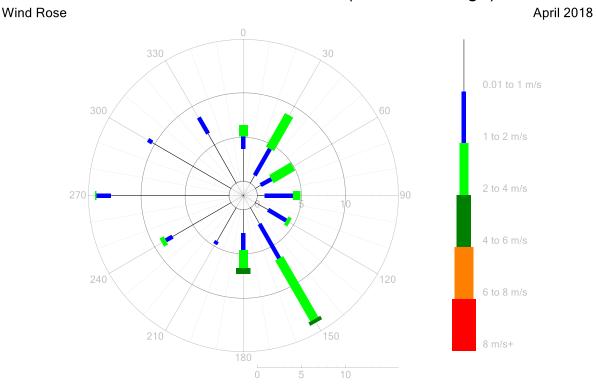

0.0% calm 99.4% valid data present

Figure 11: Saint Lukes Park – Wind Rose for April 2018

**Report No: DAT13156** 

## WestConnex



## **6.0 Valid Data Exception Tables**

Tables 20 to 25 below detail all changes made to the raw data set during the validation process. An explanation of reasons given in the table can be found in Appendix 2.

**Table 20: Allen Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	01/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	1/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following spans and zero checks	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	1/05/2018
01/04/18 02:20	30/04/18 18:45	Intermittent data transmission errors	CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , WS, WD, Sigma	АА	1/05/2018
01/04/18 23:50	30/04/18 23:50	Background checks, once daily for 5 minutes	со	АА	1/05/2018
11/04/18 13:40	11/04/18 14:00	Non-scheduled maintenance performed	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	АА	1/05/2018
16/04/18 14:00	16/04/18 15:00	Power interruption	All parameters	AA	1/05/2018
26/04/18 08:00	26/04/18 10:00	Scheduled monthly maintenance performed	All parameters	АА	1/05/2018
27/04/18 00:00	27/04/18 00:00	Instrument fault- flow error	PM <sub>2.5</sub>	АА	1/05/2018

**Table 21: Concord Oval Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	30/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	1/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following automatic span and zero checks	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	1/05/2018

**Report No: DAT13156** 



Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 22:45	30/04/18 23:45	Background checks, once daily for 5 minutes	СО	AA	1/05/2018
01/04/18 05:35	30/04/18 23:10	Intermittent data transmission errors	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	1/05/2018
24/04/18 09:00	24/04/18 12:15	Scheduled monthly maintenance performed	All parameters	AA	1/05/2018
25/04/18 00:00	25/04/18 00:00	Instrument fault- flow fault	PM <sub>2.5</sub>	AA	1/05/2018

**Table 22: Haberfield Public School Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	30/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following automatic spans, zero checks and background checks	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 01:35	30/04/18 23:00	Intermittent data transmission errors	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 07:45	14/04/18 20:35	Intermittent unrealistic negative/noisy data	PM <sub>10</sub>	AA	7/05/2018
01/04/18 23:45	30/04/18 23:45	Background checks, once daily for 5 minutes	СО	AA	7/05/2018
15/04/18 01:35	15/04/18 23:40	Linear offset of A=0ppm and B=0.15ppm applied to correct baseline drift	со	AA	7/05/2018
16/04/18 22:15	16/04/18 22:20	Additional background check followed by instrument stabilisation	СО	AA	7/05/2018
17/04/18 01:35	17/04/18 23:40	Linear offset of A=0ppm and B=0.109ppm applied to correct baseline drift	со	AA	7/05/2018
23/04/18 07:00	23/04/18 12:00	Scheduled monthly maintenance performed followed by instrument stabilisation	All parameters	AA	7/05/2018

**Report No: DAT13156** 



Start Date	End Date	Reason	Change Details	User Name	Change Date
24/04/18 00:00	24/04/18 00:00	Instrument fault- flow fault	PM <sub>2.5</sub>	AA	7/05/2018
26/04/18 12:55	26/04/18 14:45	Non-scheduled maintenance performed followed by instrument stabilisation	All parameters	AA	7/05/2018

**Table 23: Powells Creek Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	30/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following spans and zero checks	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 03:25	30/04/18 23:45	Intermittent data transmission errors	PM <sub>2.5</sub> , CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 15:30	30/04/18 15:30	Background checks, once daily for 5 minutes	СО	AA	7/05/2018
03/04/18 06:10	30/04/18 14:50	Intermittent unrealistic negative data	NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
06/04/18 08:50	06/04/18 09:00	Brief power interruption	CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , WS, WD, Sigma, AT2m, AT10m, PM <sub>10</sub>	AA	7/05/2018
26/04/18 10:00	26/04/18 11:50	Scheduled monthly maintenance performed followed by instrument stabilisation	All parameters	АА	7/05/2018
27/04/18 00:00	27/04/18 00:00	Instrument flow fault	PM <sub>2.5</sub>	AA	7/05/2018

**Report No: DAT13156** 



**Table 24: Ramsay Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	30/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	8/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following automatic span and zero checks	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	8/05/2018
01/04/18 16:30	30/04/18 23:35	Intermittent data transmission errors	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	8/05/2018
01/04/18 23:45	30/04/18 23:45	Background checks, once daily for 5 minutes	со	AA	8/05/2018
02/04/18 17:00	14/04/18 20:30	Intermittent unrealistic negative readings	PM <sub>10</sub>	AA	8/05/2018
11/04/18 10:40	18/04/18 11:10	Intermittent unrealistic negative data	NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	8/05/2018
23/04/18 11:00	23/04/18 15:05	Scheduled monthly maintenance performed followed by instrument stabilisation	All parameters	AA	8/05/2018
24/04/18 00:00	24/04/18 00:00	Instrument fault- flow error	PM <sub>2.5</sub>	AA	8/05/2018
30/04/18 14:30	30/04/18 14:40	Brief power interruption	CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , AT 2m, AT 10m, WS, WD, Sigma, PM <sub>10</sub>	AA	8/05/2018
30/04/18 14:45	01/05/18 00:00	Instrument fault- wind data not available	WS, WD, Sigma	AA	8/05/2018

**Report No: DAT13156** 



**Table 25: Saint Lukes Park Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/04/18 01:00	30/04/18 01:25	Automatic span and zero checks, once daily for 25 minutes	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 01:30	30/04/18 01:30	Intermittent stabilisation following automatic span, zero checks and background checks	со	АА	7/05/2018
01/04/18 04:10	30/04/18 23:55	Intermittent data transmission errors	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	AA	7/05/2018
01/04/18 22:45	03/04/18 22:45	Background checks, once daily for 5 minutes	со	АА	7/05/2018
04/04/18 07:50	04/04/18 08:50	Power interruption	CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , AT 2m, AT 10m, WS, WD, Sigma, PM <sub>10</sub>	АА	7/05/2018
04/04/18 23:45	30/04/18 23:45	Background checks, once daily for 5 minutes	СО	AA	7/05/2018
05/04/18 00:00	30/04/18 08:00	Intermittent instrument fault- Flow fault	PM <sub>2.5</sub>	AA	7/05/2018
24/04/18 11:00	24/04/18 13:30	Scheduled monthly maintenance performed followed by instrument stabilisation	All parameters	AA	7/05/2018

**Report No: DAT13156** 

## WestConnex



## 7.0 Report Summary

- Percentage availability for all parameters at M4 East Project was above 95%, refer to Table 12, and Tables 20-25 for details.
- There were some PM<sub>10</sub> and PM<sub>2.5</sub> recorded readings over the Exceedence Levels for the reporting period, refer to section 5.2 for details.

#### **Report No: DAT13156**

#### WestConnex



## **Appendix 1 - Definitions & Abbreviations**

ERS Environmental Reporting Services

AQMS Air Quality Monitoring Station

AQM Air Quality Monitor

BAM Beta Attenuation Monitors

TEOM Tapered Element Oscillating Microbalance

° Degrees (True North)

K Kelvin

Micrograms per cubic metre at standard temperature and pressure (0°C and 101.3

kPa)

AT Ambient Temperature

Wind conditions where the wind speed is below the operating range of the wind calm

sensor

CO Carbon monoxide

mg/m³ Milligrams per cubic metre at standard temperature and pressure (0°C and 101.3

kPa)

mm Millimeters

NO Nitric oxide

NO<sub>2</sub> Nitrogen dioxide

NO<sub>x</sub> Oxides of nitrogen

PM<sub>10</sub> Particulate less than 10 microns in equivalent aerodynamic diameter

PM<sub>2.5</sub> Particulate less than 2.5 microns in equivalent aerodynamic diameter

ppb Parts per billion

# **Report No: DAT13156**

## WestConnex



pphm Parts per hundred million

RH Relative Humidity

WD Vector Wind Direction

WS Vector Wind Speed

**Report No: DAT13156** 

#### WestConnex



## **Appendix 2 - Explanation of Exception Table**

**Automatic filter tape advance** refers to the movement of the filter paper by the analyser to an unused spot.

**Automatic background check** refers to when analyser samples zero air and measures the level of the concentration voltage. This voltage is taken as the zero signal level and this value is subtracted from any subsequent readings as an active zero compensation. This is the analyser's fine zero measurement.

**Automatic span/zero check.** The E-Sampler is programmed to perform a zero calibration check whereby air is passed through filter element, removing particulates, before entering the sensor in the analyser. Data is invalidated when these checks occur.

**Beta count failure** refers to a fault in the functioning of the EBAM. A one minute beta count was less than the maximum acceptable counts during operation.

**Calibration check outside tolerance** refers to when the calibration values are outside the tolerance limits set for the precision check.

Calibration correction factor applied to data refers to an offset or multiplier applied to the data. This operation may be performed for a number of reasons including: (a) when a clear trend / drift outside the tolerance limit can be demonstrated by repeated operation precision checks, (b) when a correction is required on previously logged data due to a calibration check being outside the allowable tolerance

**Commissioning** refers to the initial setup and calibration of the instrument when it is first installed. For some instruments there may be a stabilisation period before normal operation commences.

**Data transmission error** refers to a period of time when the instrument could not transmit data. This may be due to interference, or a problem with the phone line or modem.

**Equipment malfunction/instrument fault** refers to a period of time when the instrument was not in the normal operating mode and did not measure a representative value of the existing conditions.

**Gap in data/data not available** refers to a period of time when either data has been lost or could not be collected.

**Instrument Alarm** refers to an alarm produced by the instrument. A range of alarms can be produced depending on how operation of the instrument is being affected.

## **Report No: DAT13156**

#### WestConnex



**Instrument out of service** refers to a lack of data due to an instrument being shut down for repair, maintenance, or factory calibration.

**Linear offset or multiplier** refers to when an offset or multiplier has been applied between two points where the values of the offset or multiplier are different and the correction is interpolated between the two points.

**Logger error** refers to when an error occurs and instrument readings are not correctly recorded by the logger.

**Maintenance** refers to a period of time when the logger/instrument was switched off due to maintenance.

Overnight span/zero out of tolerance refers to when the span/zero reading measured by the analyser during an automatic precision check falls outside of the expected concentration limits.

**Overnight zero out of tolerance** refers to when the automatic zero reading measured by the analyser falls outside the expected limits.

Power Interruption refers to no power to the station therefore no data was collected at this time.

**Remote Calibration** refers to when a technician remotely connects to the station and manually performs a span check.

**Static offset or multiplier** refers to when a single offset or multiplier has been applied to the data between two points either to increase or decrease the measured value.

**Tape break** refers to the breaking of the EBAM/BAM sample tape during operation.

**Warm up after power interruption** refers to the startup period of an instrument after power has been restored.



